
Sektion 2. Utlandstillverkad flygmateriel

TITEL: Kontroll av huvudrotorblad för limsläpp, sprickor och korrosion.

GÄLLER: Gäller modellerna SE 3160, SA 316B, SA 316C, och SA 319B med installerade rotorblad angivna i bifogad kopia av DGAC AD 98-285-057(A) R1.

ÅTGÄRD: Utför åtgärder angivna i DGAC AD 98-285-057(A) R1

TID FÖR ÅTGÄRD: Enligt 3.1; 3.2 och 3.3 under compliance i DGAC AD 98-285-057(A) R1

UNDERLAG: DGAC AD 98-285-057(A) R1 och där angivna underlag.

REFERENS: DGAC AD 98-285-057(A) R1

BESLUTSDATUM: 1999-01-25

LFS 1999:9

Åtgärder enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.

Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senast gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

Postadress	Gatuadress	Telefonnummer	Telegram	Telex
601 79 NORRKÖPING	Vikboplan 11	011-192000	Civilair Norrköping	62450

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of 'Consigne de Navigabilité' ref. : 98-285-057(A) R1
In case of any difficulty, reference should be made to the French original issue.

EUROCOPTER

SA 316/319 Helicopters

Main Rotor Blades - Bonding of Blade Skin and Blade Root Reinforcement Strip

1. EFFECTIVITY

This Airworthiness Directive applies to SE 3160, SA 316B, SA 316C and SA 319B helicopters fitted with main rotor blades bearing the following part numbers :

3160S11-10000 - all part numbers,	3160S11-30000 - all part numbers,
3160S11-35000 - all part numbers,	3160S11-40000 - all part numbers,
3160S11-45000 - all part numbers,	3160S11-50000 - all part numbers,
3160S11-55000 - all part numbers.	

2. REASON

This Airworthiness Directive is issued following the failure of a main rotor blade on a SE 3130 helicopter.

3. COMPLIANCE

The actions defined in paragraph 4 must be undertaken :

- 3.1. Within 25 flying hours or 6 months (at the first limit reached), from the effective date of the original issue of this Airworthiness Directive.
- 3.2. Then every 100 flying hours or every 6 months (at the first limit reached).
In case of separation inside the non-hatched area of the strip, the check interval is reduced to 25 flying hours.
- 3.3. Before putting into service a blade held as spares.

4. MANDATORY ACTIONS

- 4.1. Check the spar skin and the blade root reinforcement strip area for separations, cracks and corrosion, in accordance with the procedure defined in paragraph 2 of referenced SA 316/319 Service Bulletin No. 05.92 R1.

.../...

n/DJ

December 16, 1998

EUROCOPTER
AS 316/319 Helicopters

98-285-057(A) R1

- 4.2. The rotor blade must be withdrawn from service before resuming flights, if there is any separation, crack or corrosion within the criteria defined in the paragraph 2.B of Service Bulletin referenced below.

REF. : EUROCOPTER SA 316/319 Service Bulletin No. 05.92 R1.

I This Revision 1 replaces AD 98-285-057(A) dated July 15, 1998.

EFFECTIVE DATES :

Original AD : On receipt from JULY 15, 1998
Revision 1 : On receipt from DECEMBER 16, 1998