
Sektion 2. Utlandstillverkad flygmateriel

TITEL: Byte av bränslemunstycke

GÄLLER: ARRIUS 1A och 1E

ÅTGÄRD: Utför åtgärder angivna i bifogad kopia av DGAC AD 2000-532(A)

TID FÖR ÅTGÄRD: Byte i intervaller angivet i Service Bulletin TURBOMECA No. A319 73 0071 eller senare utgåva

UNDERLAG: Service Bulletin TURBOMECA No. A319 73 0071

REFERENS: DGAC AD 2000-532(A)

BESLUTSDATUM: 4 januari 2001

LFS 2001:4

Åtgärder enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.
Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senast gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

Postadress	Gatuadress	Telefonnummer	Faxnummer	Telegram	Telex
601 79 NORRKÖPING	Vikobplan 11	011-19 20 00	011-19 25 75	Civilair Norrköping	62450

GSAC

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of 'Consigne de Navigabilité' ref. : 2000-532(A)
In case of any difficulty, reference should be made to the French original issue.

TURBOMECA

ARRIUS 1 turboshaft engines

Fuel injection (ATA 73)

1. APPLICABILITY:

This Airworthiness Directive applies to all TURBOMECA ARRIUS 1A and 1E turboshaft engines.

2. REASONS:

During inspections carried out at the repair workshop, it was found that some main fuel injectors were totally or partially blocked ; blockage of the injectors may lead to engine flame out during engine deceleration or impossibility to obtain 2 ½ minute OEI rating.

3. COMPLIANCE:

In order to prevent blockage of the injectors, it is mandatory to apply the following measure:

Replace periodically fuel main injectors with more than 1250 operating hours, according to Service Bulletin TURBOMECA No. A319 73 0071 (or further issue).

REF. : Service Bulletin TURBOMECA No. A319 73 0071
(or further issue).

EFFECTIVE DATE : JANUARY 06, 2001

n/JFS

December 27, 2000

TURBOMECA
ARRIUS 1 turboshaft engines

2000-532(A)