
Sektion 2. Utlandstillverkad flygmateriel

TITEL: Kontroll av vinsch.

GÄLLER: Eurocopter Modell 355 F, F1, F2 och N utrustade med elektrisk vinsch
BREEZE P/N BL 29700-23

ÅTGÄRD: Utför åtgärd enligt bifogad kopia av DGAC AD 2002-028-066(A).

TID FÖR ÅTGÄRD: Före vinschning och därefter i enlighet med DGAC AD 2002-028-066(A).

UNDERLAG: Eurocopter AS 355 Alert Telex No. 25.00.68

REFERENS: DGAC AD 2002-028-066(A).

BESLUTSDATUM: 6 februari 2002

LFS 2002:27

Åtgärder enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.
Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senast gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

Postadress	Gatuadress	Telefonnummer	Faxnummer	Telegram	Telex
601 79 NORRKÖPING	Vikobplan 11	011-19 20 00	011-19 25 75	Civilair Norrköping	62450

GSAC

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of 'Consigne de Navigabilité' ref. : 2002-028-066(A)
In case of any difficulty, reference should be made to the French original issue.

EUROCOPTER

AS 355 helicopters

BREEZE 450-lb electric hoist (ATA 25)

1. EFFECTIVITY:

This Airworthiness Directive applies to AS 355 helicopters, versions F, F1, F2 and N equipped with BREEZE 450-lb electric hoist P/N BL 29700-23.

Caution: This Airworthiness Directive is intended for maintenance personnel and crews.

2. REASON:

This Airworthiness Directive is issued to prevent any risk of hoist cable damage not being discovered in the event of a malfunction of the up end-of-travel cable stop mechanism.

3. MANDATORY ACTIONS AND COMPLIANCE TIME:

The following actions are rendered mandatory from the effective date of this Airworthiness Directive.

- 3.1. Before the next hoisting mission and on each installation of a hoist on the helicopter, on the ground, check the damper assembly spring compression and perform a dimensional check of the buffer of this assembly, in compliance with the instructions described in paragraphs 2.1.a) and 2.1.b) of referenced EUROCOPTER AS 355 Alert Telex No. 25.00.68.
- 3.2. At the latest every 50 hoisting cycles or every 3 months (whichever limit is reached first), perform a dimensional check of the damper assembly buffer, in compliance with the instructions described in paragraph 2.1.b) of the referenced Alert Telex.
- 3.3. During each hoisting mission and each time the cable is in the up end-of-travel stop position, check the hook in the up position, in compliance with the instructions described in paragraph 2.2 of the referenced Alert Telex.

REF.: EUROCOPTER AS 355 Alert Telex No. 25.00.68.

EFFECTIVE DATE : JANUARY 19, 2002

n/DJ

January 09, 2002

EUROCOPTER
AS 355 helicopters

2002-028-066(A)