

SWEDISH AIRWORTHINESS DIRECTIVES (SAD)

SAD No 1-100 Cancels SAD No 1-062

Section 1. Swedish Manufactured Aeronautical Products

AIRWORTHINESS

DIRECTIVE No:

1-100

AIRCRAFT TYPE:

Saab Safir 91A, 91B, 91B-2, 91C and 91D

SERIAL No:s

AFFECTED:

All series numbers

SUBJECT:

Inspection of U-profile in main spar of fuselage for corrosion and repair

of damages that may be revealed.

BACKGROUND:

Corrosion damages have been revealed in the upper and lower U-profile of the fuselage main spar of the aircraft. The profile is exposed to heavy stress from the wing loads transferred in the wing coupling brackets attached to the profile. The corrosion damages may have been caused by grass and dirt being thrown up from the main landing gear wheels and intercepted by the U-profile of the main spar. The grass and dirt also may cause that the drain holes of the U-profile will be plugged up and there will be a risk of corrosion due to undrained moisture. In acidiferous environments this risk will increase.

SAD 1-062 required inspection of the lower U-profile only. Experience has shown that also the upper profile may be subject to corrosion damage.

REFERENCE

DOCUMENTS:

Saab 91 Safir Service bulletin Number 91.1.1.006, revision 1, dated

August 29 1996.

ACTIONS:

Perform actions described in Saab 91 Safir service Bulletin Number

91.1.006, revision 1, dated August 29, 1996 or later revision.

COMPLIANCE

TIME:

Not later than 1 January, 1997, and to be repeated annually.

EFFECTIVE

DATE:

30 August, 1996

LUFTFARTSVERKET Flight Safety Department

LFS:1996:54

The actions contained in this directive and reference document(s) have been classified as mandatory for aircraft on Swedish register.

Mail address

S-601 79 NORRKÖPING

SWEDEN

Office address

Vikboplan 11

Telephone No

Cable address

Telex address

Nat 011 - 19 20 00 Int + 46 11 - 19 20 00 Civilair

Norrköping

64250