

Sektion 2. Utlandstillverkad flygmateriel

TITEL: Kontroll av fästkruvar för servoenhet

GÄLLER: AS 350 B, B1, D med installerad DUNLOP servo kontroller med
P/N: AC 64182, AC 67034,
AC 67030, AC 67246,
AC 67244, AC 66436,
AC 66442, AC 67032.

ÅTGÄRD: Utför åtgärder angivna i bifogad kopia av DGAC AD 88-184-052(B)R1.

**TID FÖR
ÅTGÄRD:** Inom 50 flygtimmar räknat från detta LVD's utgivningsdatum.

UNDERLAG: DGAC AD 88-184-052(B)R1
EUROCOPTER FRANCE AS 350 SB Nr 01-21 R1
DUNLOP SB Nr 65-10 R1.

REFERENS: DGAC AD 88-184-052(B)R1

**UTGIVNINGS-
DATUM:** 1993-09-09

LFS: 1993:24

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

BUREAU VERITAS

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspections and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive

Translation of 'Consigne de Navigabilité'

Réf.: 88-184-052(B)R1

In case of any difficulty, reference should
be made to the French original issue.

EUROCOPTER FRANCEAS 350 Helicopters

DUNLOP Servocontrols

This Airworthiness Directive covers AS 350 B, B1, D helicopters fitted with the following DUNLOP main and tail servocontrols :

P/N AC 64182, AC 67034,
AC 67030, AC 67246,
AC 67244, AC 66436,
AC 66442, AC 67032.

In order to ensure the integrity of the servocontrol assembly bolts, the following measures are rendered mandatory from the effective date of this Airworthiness Directive :

- 1 - Within the next 50 flying hours or at the latest by December 31, 1988 (whichever limit is reached first), identify the servocontrol bolts with the letters "HK" marked on their heads, as specified in paragraph 2A of DUNLOP S.B. n° 65-10, appended to AEROSPATIALE AS 350 S.B. n° 01-21.
- 2 - Replace the assembly bolts marked with the letters "HK" on their heads with the checked bolts supplied by DUNLOP after July 1, 1988 (as specified in paragraph 2B of DUNLOP S.B. n° 65-10, appended to AEROSPATIALE AS 350 S.B. n° 01-21 :
 - on the servocontrols in service : within the next 50 flying hours according to the identification and in any event before February 1, 1989,

.../...

July 21, 1993

EUROCOPTER FRANCE
AS 350 Helicopters

88-184-052 (B)R1


n/W

- on the spare servocontrols in stock : before they are put into service, and in any event before February 1, 1989.
- 3 - Scrap immediately all bolts with the following part numbers in stock, and which were procured before July 1, 1988 :
 - . DSR 54153-1204, -1205, -1206, -1209 and -1211

NOTE :

The assemblies fitted with bolts checked and possibly replaced by DUNLOP between July 1, 1988 and January 1, 1993 have a yellow mark adjacent to the breather hole in the extension piece. Since January 1, 1993, the assemblies delivered by DUNLOP no longer bear this yellow mark but are identified by the index RA 000 (and the following digits) which precedes the serial number.

Ref. - EUROCOPTER FRANCE AS 350 S.B. n° 01-21 R1
- DUNLOP S.B. n° 65-10 R1.

The present Revision 1 replaces the original AD N° 88-184-052(B) dated December 14, 1988

EFFECTIVE DATES :

Original AD : DECEMBER 24, 1988
Revision 1 : JULY 31, 1993