
Sektion 2. Utlandstillverkad flygmateriel

Denna LVD har utfärdats för att omfatta alla de nationella luftfartyg som inte regleras av EASA utan av det svenska regelverket BCL-M.

TITEL: Inspektion/byte av Brandsläckare Halon 1211

GÄLLER: Brandsläckare Halon 1211(BCF), märkt med Part nummer(P/N) och serie nummer (s/n) i Fire Fighting Enterprises Ltd (FFE) Alert Service bulletin ASB 26-115 utfärdande C, daterad januari 2010.

REVISION: Revision 2 har blivit utgiven på grund av utfärdandet av en ny revision på Alert Service bulletin ASB 26-115 utfärdande C, daterad januari 2010.

ÅTGÄRD: Utför åtgärder i enlighet med bifogad EASA AD 2009-0262R1. Refererad AD finns även tillgänglig på följande Internetadress:
<http://ad.easa.europa.eu/>

TID FÖR ÅTGÄRD: Enligt EASA AD 2009-0262R1, men med denna LVD:s beslutsdatum som utgångspunkt.

UNDERLAG: Fire Fighting Enterprises Limited Alert Service bulletin ASB 26-115 utfärdande C daterad, Januari 2010 eller senare revision som finns tillgänglig på följande internetadress: <http://www.firecmm.com/>

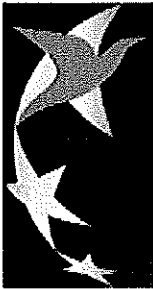
REFERENS: EASA AD 2009-0262R1

BESLUTSDATUM: 12 februari 2010

BESLUT: TSL 2010-635

Åtgärder enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.
Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senast gällande revision/utgåva.

Postadress	Gatuadress	Telefonnummer	Faxnummer
601 73 NORRKÖPING	Vikboplan 7	0771-503 503	011-415 22 50

EASA	AIRWORTHINESS DIRECTIVE
	<p>AD No.: 2009-0262R1</p> <p>Date: 27 January 2010</p> <p>Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.</p>
<p>This AD is issued in accordance with EC 1702/2003, Part 21A.3B. In accordance with EC 2042/2003 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [EC 2042/2003 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [EC 216/2008, Article 14(4) exemption].</p>	
Type Approval Holder's Name:	Type/Model designation(s):
Fire Fighting Enterprises Limited	Halon 1211 Fire Extinguishers
Approval Number: Various National approvals.	
Foreign AD:	Not applicable
Revision :	This AD revises and replaces EASA AD 2009-0262 dated 15 December 2009.
ATA 26	Fire Protection – Halon 1211 Fire Extinguishers – Identification / Replacement
Manufacturer(s):	Fire Fighting Enterprises Limited
Applicability:	<p>Halon 1211 (BCF) fire extinguishers, identified by Part Number (P/N) and serial number (s/n) in Fire Fighting Enterprises Ltd (FFE) Alert Service Bulletin (ASB) 26-115.</p> <p>The affected fire extinguishers are used in passenger cabins and lavatory waste bins and are known to be installed (or carried/stowed on board) on, but not limited to, 328 Support Services (Dornier), Airbus, Alenia, BAE Systems, Boeing, Embraer, and Fokker transport aeroplanes, Adam Aircraft Industries, AerMacchi, Aircraft Industries a.s (formerly LET), Britten Norman, Hawker Beechcraft (formerly Raytheon), Pilatus, and Vulcanair (formerly Partenavia) general aviation aeroplanes and Agusta and Eurocopter helicopters.</p>
Reason:	<p>The Civil Aviation Authority of the United Kingdom (UK) has informed EASA that significant quantities of Halon 1211 gas, determined to be outside the required specification, have been supplied to the aviation industry for use in fire extinguishing equipment. Halon 1211 (BCF) is used in lavatory waste bin fire extinguishers and portable fire extinguishers, usually fitted or stowed in aircraft cabins and toilet compartments.</p> <p>EASA published Safety Information Bulletin (SIB) 2009-39 on 23 October 2009 to make the aviation community aware of this safety concern. On 25 November 2009, EASA Emergency AD 2009-0251E was published to address an earlier batch of extinguishers with contaminated Halon 1211.</p> <p>The results of the ongoing investigation have now established that LyonTech Engineering Ltd, a UK-based company, has supplied further consignments of</p>

	<p>Halon 1211 (BCF) to Fire Fighting Enterprises (FFE) that do not meet the required specification. This Halon 1211 has subsequently been used to fill certain FFE portable cabin and toilet compartment fire extinguishers that are now likely to be installed in or carried on board aircraft.</p> <p>The contaminated nature of this gas, when used against a fire, may provide reduced fire suppression, endangering the safety of the aircraft and its occupants. In addition, extinguisher activation may lead to release of toxic fumes, possibly causing injury to aircraft occupants.</p> <p>For the reason described above, this EASA AD requires the identification and removal from service of certain batches of fire extinguishers and replacement with serviceable units.</p> <p>This AD has been revised to refer to the latest revision of the FFE Alert Service Bulletin, which has been re-issued to correct some typographical errors in the listed serial numbers.</p>
Effective Date:	<p>Revision 1 : 10 February 2010</p> <p>Original Issue : 29 December 2009</p>
Required Action(s) and Compliance Time(s):	<p>Required as indicated, unless accomplished previously:</p> <p>(1) Within the next 30 days after the effective date of the original issue of this AD, accomplish the following:</p> <p>(1.1) Identify the P/N and s/n of the fire extinguisher(s) installed or carried on board the aircraft, as listed in Appendix 1 of FFE ASB 26-115, and</p> <p>(1.2) If any fire extinguisher identified as required by paragraph (1.1) of this AD is listed in Appendix 1 of FFE ASB 26-115, remove it from the aircraft and replace it with a serviceable unit in accordance with the instructions of FFE ASB 26-115.</p> <p>(2) From the effective date of this AD, do not install any fire extinguisher as identified in Appendix 1 of FFE ASB26-115 on any aircraft.</p>
Ref. Publications:	Fire Fighting Enterprises Ltd ASB 26-115 Issue C, dated January 2010.
Remarks:	<ol style="list-style-type: none"> If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD. The required actions and the risk allowance have granted the issuance of a Final AD with Request for Comments, postponing the public consultation process after publication. Enquiries regarding this AD should be referred to the Airworthiness Directives, Safety Management & Research Section, Certification Directorate, EASA. E-mail: ADs@easa.europa.eu. For any question concerning the technical content of the requirements in this AD, please contact: Fire Fighting Enterprises Ltd, 9 Hunting Gate, Hitchin, Hertfordshire SG4 0TJ, United Kingdom Telephone: +44 (0) 845 402 4242 E-mail: info@ffeuk.com, Website: www.ffeuk.com FFE ASB 26-115 can be accessed via the FFE website at www.firecmm.com.