

Sektion 2. Utlandstillverkad flygmateriel

**TITEL:**                    **Byte av huvudrotorblad**

**GÄLLER:**                SA 315 B (LAMA) med huvudrotorblad P/N 3160S.11.30.000 eller  
.40.000. S/N 15227 t o m 15329 utan AMS AEROSPATIALE  
07 2258   införd.

**ÅTGÄRD:**                Som följd av upptäckt utmattningsproblemm i  
bladbalk/infästningsenhet, vilket kan leda till bladseparation, är  
livstiden för huvudrotorbladen reducerad till 400 flygtimmar.

**TID FÖR**  
**ÅTGÄRD:**                Inom tider i para 1. och 2. nedan räknat från detta LVD:S  
utgivningsdatum.

1. Rotorblad med flygtid över 375 flygtimmar skall tagas ur tjänst  
inom 25 flygtimmar.

2. Rotorblad med flygtid under 375 flygtimmar skall tagas ur tjänst  
före 400 flygtimmar.

**UNDERLAG:**            DGAC 89-162-032(B)R1. Bifogad kopia.

**REFERENS:**            DGAC 89-162-032(B)R1 och skrivelse L 9005-1184-31202 daterad  
1990-05-15 till ägare/innehavare.

**UTGIVNINGS-**  
**DATUM:**                1990-06-21

**LFS: 1990:20**

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.  
Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med  
hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges  
i luftfartsverkets författningssamlingar LFS.

# AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

*Inspections and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.*

Translation of 'Consigne de Navigabilité'

Réf.: 89-162-032(B)R1

In case of any difficulty, reference should be made to the French original issue.

## AEROSPATIALE SA 315 B (LAMA) helicopters

Main Rotor Blades  
Service-Life limit

The present Airworthiness Directive applies to AEROSPATIALE SA 315 B (LAMA) helicopters equipped with main rotor blades P/N 3160S.11.30.000 or .40.000, serial numbers 15227 to 15329 inclusive without the AMS AEROSPATIALE 07 2258.

Subsequent to the discovery of a fatigue problem at the blade spar/fitting assembly, which could lead to loss of the blade, the service-life limit of the blades identified above is reduced to 400 hours. From the effective date of this Airworthiness Directive :

- 1 - blades which have logged more than 375 hours, must be removed from service within the next 25 flying hours.
- 2 - blades which have logged less than 375 hours must be removed from service before they reach 400 flying hours.

The present Revision 1 cancels and replaces the original AD 89-162-032(B) of October 18, 1989

EFFECTIVE DATE : OCTOBER 28, 1989  
(date of original AD)

April 18, 90

AEROSPATIALE SA 315 B (LAMA)  
helicopters

89-162-032(B)R1

e/W