

Sektion 2. Utlandstillverkad flygmateriel

TITEL: Kontroll av kulblästring på omställningsaxel för stjärtrotor

GÄLLER: SA 315B Lama, utrustade med axel P/N 3160S66.00.001.3 med
| S/N lägre än 20550 och modifierade enligt AMS 2178.

ÅTGÄRD: Kontrollera att kulblästring av axelradien i övergången från
axelsplines är korrekt utförd enligt AEROSPATIALE LAMA SA 315B
| Service Bulletin nr 01-19R1.

TID FÖR
ÅTGÄRD: Inom 50 flygtimmar räknat från detta LVD's utgivningsdatum enligt
| bifogad kopia av DGAC AD 84-084-027(B)R1.

UNDERLAG: | AEROSPATIALE LAMA 315B Service Bulletin Nr 01-19R1 eller
senare utgåva.

REFERENS: | DGAC AD 84-084-028(B)R1.

UTGIVNINGSDATUM: 1992-01-30

LFS: 1992:2

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspections and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive

Translation of 'Consigne de Navigabilité'

Réf.: 84-084-027(B)R1

In case of any difficulty, reference should be made to the French original issue.

AEROSPATIALE helicopters ALOUETTE III SA 315B LAMA

Tail rotor pitch change control rod

The present Airworthiness Directive applies to subject aircraft equipped with a control rod P/N 3160S66.00.001.3 with a serial number less than 20550 fitting the tail rotor gear boxes modified to AMS 2178.

With the aim of ensuring that the shot peening introduced by AMS 2178 in the fillet between the splines and shank of the control rod, is correctly carried out, the following checks and corrective actions, outlined by the AEROSPATIALE LAMA SA 315 Service Bulletin n° 01.19 R1, have been rendered mandatory and must be complied with :

- Within the 50 operating hours following effective date of the present Directive :
 - A/ For the new tail gear boxes accumulating 700 operating hours and more.
 - B/ For the tail gear boxes which have been already overhauled.
- Before the accumulation of 750 operating hours for the tail gear boxes logging less than 700 operating hours.
- Prior to the installation on helicopter of a tail gear box modified to AMS 2178.

Should the shot peening be imperfectly carried out, proceed with replacement of the control rod, at the latest within the 50 operating hours following the inspection, in conformity with the procedures detailed in the appendix to AEROSPATIALE LAMA 315B Service Bulletin n° 01-19 R1.

y/w

December 11, 91

AEROSPATIALE HELICOPTERS
ALOUETTE III SA 315B LAMA

84-084-027(B)R1

Ref. : AEROSPATIALE LAMA SA 315B S.B.n° 01-19 R1

The present Rev. 1 supersedes AD 84-084-027(B) dated May 23, 1991

EFFECTIVE DATES:

Original issue : MAY 30, 1984

Rev. 1 : DECEMBER 21, 1991