

LUFTVÄRDIGHETSDIREKTIV (LVD)

Luftfartyg Allmänt LVD nr 2472

Sektion 2. Utlandstillverkad flygmateriel

TITEL:

Kontroll och ev byte av magnetströmbrytare

GÄLLER:

Magnetströmbrytare tillverkade av ACS Products Company and Gerdes Products Company installerade i, men ej begränsat till, Piper Modell PA-38-112, Schweizer Modell G-164 serierna (modell G-164A, G-164B och G-164C), Schweizer Modell 2-37 och 2-37A,

och Cessna angivna i bifogad kopia av FAA AD

93-05-06.

ÅTGÄRD:

Utför åtgärder angivna i FAA AD 93-05-06

<u>TID FÖR</u> ÅTGÄRD:

Inom 100 flygtimmar eller nästa årstillsyn, vilket som först inträffar,

därefter i intervall av 2000 flygtimmar.

UNDERLAG:

FAA AD 93-05-06, ACS Service Bulletin SB 92-01 daterad

15 augusti 1992, eller Cessna Service Bulletin SEB 91-5 revision 1

daterad 14 juni 1991.

REFERENS:

FAA AD 93-05-06

UTGIVNINGS-

DATUM:

1993-05-06

LFS: 1993:17

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarende flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

Vikboplan 11



AIRWORTHINESS DIRECTIVE

FLIGHT STANDARDS SERVICE REGULATORY SUPPORT DIVISION P.O. BOX 26460 OKLAHOMA CITY, OKLAHOMA 73125-0460 U.S. Department of Transportation Federal Aviation Administration

The following Almorthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Federal Aviation Regulations, Part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference FAR Subpart 39.3).

93-05-06 ACS PRODUCTS COMPANY AND GERDES PRODUCTS COMPANY: Amendment 39-8511. Docket 92-NM-165-AD.

Applicability: ACS and Gerdes ignition switches; as installed in, but not limited to, Piper Model PA-38-112 series airplanes, Schweizer Model G-164 series (including Model G-164A, G-164B, and G-164C) airplanes, Schweizer Model 2-37 and 2-37A series airplanes, and the following Cessna airplanes; certificated in any category:

Serial Numbers Cessna Model 15079405 15074428 150 through A150 through A1500734 A1500389 F150 through F15001428 F15001024 FRA150 FRA1500212 through FRA1500336 152 15279406 through 15286033 A152 A1520735 through A1521049 F152 F15201429 through F15201980 FA152 FA1520337 through FA1520425 172 17261486 through 17276673 R172 R1722000 through R1723454 172RG 172RG0001 through 172RG1191 F172 F17201045 through F17202254 FR172 FR17200441 through FR17200675 177 17701890 through 17702752 177RG 177RG0342 through 177RG1366 F177RG F177RG0093 through F177RG0177 180 18052317 through 18053203 182 18261786 through 18268615 R18200001 R182 through R18202041 A182-0148 A182 A182-0137 through F18200001 F182 through F18200169 FR182 FR18200001 through FR18200070 185 18502154 through 18504448 U206 U20601980 through U20607020 207 20700222 through 20700788 210 21059893 21065009 through P21000001 P21000874 P210 through

Compliance: Required as indicated, unless accomplished previously. To prevent failure of ignition switches, accomplish the following:

(a) Within 100 flight hours after the effective date of this AD, or at the next annual inspection, whichever occurs first, perform an inspection of the ignition switch to detect wear and corrosion, and lubricate the switch, in accordance with ACS Service Bulletin SB92-01, dated August 15, 1992; or Cessna Service Bulletin SEB91-5, Revision 1, June 14, 1991. If wear or corrosion is detected, prior to further flight, replace the switch in accordance with the service bulletin. Repeat this inspection and lubricate the ignition switch in accordance with the service bulletin, thereafter, at intervals not to exceed 2,000 flight hours.

NOTE: ACS ignition switches that do not have a "start" position (models A-510-1 and A-510-5) or were manufactured on or after February 20, 1989, and have not accumulated 2,000 flight hours, need not be lubricated. The manufacture date is stamped on the switch body. These switches are identifiable by red paint in the screw heads on the back of the switch. However, manufacturer lubricated switches that have a "start" position, but do not have a starter solenoid diode, must be inspected and modified.

(b) Within 100 flight hours after the effective date of this AD, or at the next annual

(b) Within 100 flight hours after the effective date of this AD, or at the next annual inspection, whichever occurs first, inspect the ignition switch installation to determine if a diode or other surge suppressor is installed on the starter solenoid. If one is not installed, prior to further flight, install a starter solenoid diode in accordance with ACS Service Bulletin SB92-01, dated August 15, 1992; or Cessna Service Bulletin SEB91-5, Revision 1, dated June 14, 1991.

NOTE: For operators using the Cessna service bulletin to install the diode in the starter solenoid: The procedures for installation are contained in Attachment to Service Bulletin SEB91-5R1, Revision 1, dated June 14, 1991.

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

NOTE: Information concerning the existence of approved alternative methods of compliance

with this AD, if any, may be obtained from the Los Angeles ACO.

(d) Special flight permits may be issued in accordance with FAR 21.197 and 21.199 to

operate the airplane to a location where the requirements of this AD can be accomplished.

(e) The inspection, lubrication, replacement, and modification shall be done in accordance with ACS Service Bulletin SB92-01, dated August 15, 1992; or Cessna Service Bulletin SEB91-5, Revision 1, dated June 14, 1991, which includes Attachment to Service Bulletin SEB91-5R1, Revision 1, dated June 14, 1991. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR Part 51. Copies may be obtained from ACS Products Company, P.O. Box 152, 1585 Copper Drive, Lake Havasu City, Arizona 86403-0008; or Cessna Aircraft Company, Customer Services, P.O. Box 7704, Wichita, Kansas 67277. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Los Angeles Aircraft Certification Office, 3229 East Spring Street, Long Beach, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(f) This amendment becomes effective on April 29, 1993.

FOR FURTHER INFORMATION CONTACT:

Roy McKinnon, Aerospace Engineer, Propulsion Branch, ANM-140L, Los Angeles Aircraft Certification Office, FAA, Transport Airplane Directorate, 3229 East Spring Street, Long Beach, California 90806-2425; telephone (310) 988-5247; fax (310) 988-5210.