

Sektion 2. Utlandstillverkad flygmateriel

TITEL: Byte av bränsledräneringsventiler

GÄLLER: Zlin Z 142C S/N 0542-0550, Zlin Z 242L S/N 0540, 0541, 0651-0657.

ÅTGÄRD: Utför åtgärder angivna i bifogad kopia av Mandatory Bulletin Z 142C/3, Z 242L/6 daterad 29 juni 1993.

TID FÖR ÅTGÄRD: Inom 500 flygtimmar men senast 1 mars 1994.


UNDERLAG: Moravan Mandatory Bulletin Z 142C/3, Z 242L/6 daterad 29 juni 1993.

REFERENS: Moravan Mandatory Bulletin Z142C/3, Z242L/6 daterad 29 juni 1993.

UTGIVNINGS-DATUM: 1993-12-16

LFS: 1993:41

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

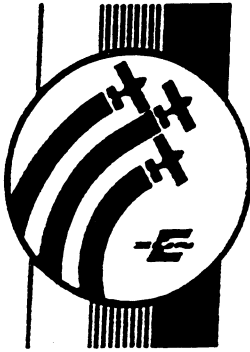

MORAVAN

akciová společnost

OTROKOVICE

LIST FASTOJNOSTI

MANDATORY BULLETIN Z 142C/3, Z 242L/6

-11- 2 6

1. SUBJECT: Airplanes Z 142C, production Nos. 0542-0550
Airplanes Z 242L, production No. 0540, 0541,
0651-0657.
2. REASON: In the above mentioned airplanes were installed
the draining valves of the fuel tanks the springs
of which have deficient surface finish.
3. MEASURES: Replace valves by the new ones; the original
ones to be returned to the producer.
4. MEASURES SHALL BE PERFORMED: During the next 500 hour check-up;
at the latest toward the end of
the year 1993.
5. SHALL BE PERFORMED BY: The user.
6. EXPENCES SHALL BE COVERED: The new parts pays the producer.
7. NECESSARY MATERIAL: The producer supplies the valves
C 142.7214-02.00 with the bulletin.
For the plane Z 142C - 5 pcs, for the
plane Z 242L - 2 pcs - see enclosure.
8. PROCEDURE: In planes indicated in the appendix unlock
and screw in the new valves, which are marked
near the hexagon's periphery by a visible centre
punch, tighten and secure by a binding wire.
The original valves send to the address:
Moravan a.s. OTS, 765 81 Otrokovice, Czech
Republik.
9. THE BULLETIN IS EFFECTIVE SINCE THE DATE OF APPROVAL BY
CIVIL AVIATION INSPECTORATE.
10. SUPPLEMENTS: Drawing of the replaced valve's positions on
planes.

..... Antonín Partika
.....
Manufacturer's representative

29.6.1993
.....
Date

..... Jan Benes
.....
Civil Aviation Inspectorate
- Prague