

Sektion 2. Utlandstillverkad flygmateriel

R2

TITEL: Förstärkning av främre säten

GÄLLER: TB9, TB10, TB20, TB21 och TB200 med säten installerade från februari 1991 och S/N angivna i bifogad kopia av DGAC AD 94-114(A) R1.

ÅTGÄRD: Utför förstärkning i enlighet med SOCATA TB SB 10-075-25 Rev 1 (KIT OPT 10-9193-00)

TID FÖR ÅTGÄRD: Vid nästa planerade underhåll eller senast inom 50 flygtimmar, räknat från detta LVD's utgivningsdatum.

UNDERLAG: DGAC AD 94-114(A)R1
SOCATA TB SB 10-075-25 Rev 1.

REFERENS: DGAC AD 94-114(A)R1

UTGIVNINGS-DATUM: 1994-08-25

LFS: 1994:29

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarende flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive

Translation of 'Consigne de Navigabilité'

ref.: 94-114(A)R1

In case of any difficulty, reference should be made to the French original issue.

SOCATA

TB9, TB10, TB20, TB21, TB200 Airplanes

Front seats

This Airworthiness Directive concerns all SOCATA TB airplanes :

- Which seats with tilting back rest have been installed from February, 1991 and up to S/N 1479, except S/N 1192, 1193, 1308, 1426 to 1433, 1448, 1461, 1462, 1464 to 1469, 1471, 1473 to 1477.

and all the seats with tilting back rest supplied or installed as spares from February, 1991 and which have no serial number.

To ensure integrity of seat with tilting back rest structure, the following measures are made MANDATORY from the effective date of this Airworthiness Directive.

- During the next maintenance scheduled inspection and within next 50 hours T.I.S. at the latest, add a weld bead on the seat with tilting back rest LH and RH external gussets to make them stronger as given in the SOCATA TB SB 10-075-25 Rev.1 (KIT OPT 10-9193-00).

Record the application of this Airworthiness Directive on the aircraft Log book.

Ref : SOCATA TB airplanes SB 10-075-25 Rev.1

This Revision 1 replaces the original AD 94-114(A) dated May 11, 1994

EFFECTIVE DATE : MAY 21, 1994
(same as the original AD)

n/Z

August 03, 1994

SOCATA
TB9, TB10, TB20, TB21, TB200 Airplanes

94-114(A)R1