

---

Sektion 2. Utlandstillverkad flygmateriel

---

**TITEL:** Kontroll av bladinfästning och blad

**GÄLLER:** Modellerna HC-92WK och HC-92ZK installerade på men ej begränsade till flygplan angivna i bifogad kopia av FAA AD 95-11-08.

**ÅTGÄRD:** Utför åtgärder angivna i FAA AD 95-11-08.

**TID FÖR ÅTGÄRD:** Inom 10 flygtimmar räknat från detta LVD's utgivningsdatum och därefter vid tider och intervaller angivna i FAA AD 95-11-08.

**UNDERLAG:** FAA AD 95-11-08  
Hartzell Propeller Inc Service Bulletin (SB) nr 202 daterad 5 januari 1995 eller senare utgåva.

**REFERENS:** FAA AD 95-11-08

**UTGIVNINGSDATUM:** 1995-07-06

**LFS: 1995:36**

Åtgärd enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11. Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senaste gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.



# AIRWORTHINESS DIRECTIVE

REGULATORY SUPPORT DIVISION  
P.O. BOX 26460  
OKLAHOMA CITY, OKLAHOMA 73125-0460

U.S. Department  
of Transportation  
**Federal Aviation  
Administration**

The following Airworthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Federal Aviation Regulations, Part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference FAR Subpart 39.3).

**95-11-08 Hartzell Propeller Inc.:** Amendment 39-9243. Docket 95-ANE-05. Supersedes AD 73-02-01, Amendment 39-1584.

**Applicability:** Hartzell Propeller Inc. Models HC-92WK-() and HC-92ZK-() propellers, installed on but not limited to the following aircraft: Aerostar Aircraft Corp. (formerly Ted Smith Aerostar) Model Aerostar 360; Air & Space America, Inc. Model 18A; Aircraft Acquisition Corp. (formerly Helio) Models H-250, 500; Beech Models 95, B95, B95A, D95A, E95; Cessna Models 172, 175, 175A; Found Brothers Aviation Ltd. Models FBA 100, FBA-2C; Kwad Company Model Super-V; Mooney Aircraft Corp. Model M20A; Piper Models PA-23, PA-24, PA-25; Procaer Model F15/B; Revo Inc. Models C2, Lake LA-4; and Simmering Graz Pauker A.G. Model SGP-222.

**NOTE 1:** This airworthiness directive (AD) applies to each propeller identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For propellers that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must use the authority provided in paragraph (e) to request approval from the Federal Aviation Administration (FAA). This approval may address either no action, if the current configuration eliminates the unsafe condition, or different actions necessary to address the unsafe condition described in this AD. Such a request should include an assessment of the effect of the changed configuration on the unsafe condition addressed by this AD. In no case does the presence of any modification, alteration, or repair remove any propeller from the applicability of this AD.

**NOTE 2:** The above is not an exhaustive list of aircraft which may contain the affected Hartzell Models HC-92WK-() and HC-92ZK-() propellers because of installation approvals made by, for example, Supplemental Type Certificate or field approval under FAA Form 337 "Major Repair and Alteration." It is the responsibility of the owner, operator, and person returning the aircraft to service to determine if an aircraft has an affected propeller.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent propeller blade separation, which could result in loss of control of the aircraft, accomplish the following:

(a) For all affected propellers, within 10 hours time in service (TIS) after the effective date of this AD, perform a blade clamp screw inspection in accordance with Procedure No. 1 of Hartzell Propeller Inc. Service Bulletin (SB) No. 202, dated January 5, 1995. If any clamp screws are loose (i.e., screws turn when applying torque in a clockwise rotation) or broken, remove propeller and send to an authorized repair station for disassembly and inspection in accordance with paragraph (b) of this AD prior to further flight.

(b) For affected propellers whose time since last blade dye penetrant inspection or compliance with AD 73-02-01 is unknown, within the next 10 hours TIS after the effective date of this AD, accomplish the following:

(1) Disassemble, perform a dye penetrant inspection of the blade shank, perform compressive rolling of the blade shank, and replace clamp socket screws with Part Number (P/N) A-321 clamp socket screws in accordance with Procedure No. 2 of Hartzell Propeller Inc. SB No. 202, dated January 5, 1995. If cracks are found during a dye penetrant inspection of the blade shank, replace with a serviceable blade that has been compressively rolled in the blade shank.

(2) At intervals not to exceed 500 hours TIS since last inspection, repeat paragraph (b)(1) of this AD. The P/N A-321 clamp screws are to be used one time only and are to be replaced with new screws each time the propeller blade clamp is disassembled.

(c) For affected propellers whose time since last blade dye penetrant inspection or compliance with AD 73-02-01 is greater than 275 hours TIS, within the next 25 hours TIS after the effective date of this AD, accomplish paragraphs (b)(1) and (b)(2) of this AD.

(d) For affected propellers whose time since last blade dye penetrant inspection or compliance with AD 73-02-01 is less than or equal to 275 hours TIS, prior to reaching 300 hours TIS since last blade dye penetrant inspection or compliance with AD 73-02-01, accomplish paragraphs (b)(1) and (b)(2) of this AD.

(e) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Chicago Aircraft Certification Office. The request should be forwarded through an appropriate FAA Maintenance Inspector, who may add comments and then send it to the Manager, Chicago Aircraft Certification Office.

NOTE 3: Information concerning the existence of approved alternative methods of compliance with this airworthiness directive, if any, may be obtained from the Chicago Aircraft Certification Office.

(f) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the aircraft to a location where the requirements of this AD can be accomplished. Special flight permits should not be issued if loose or broken screws are found.

(g) The actions required by this AD shall be done in accordance with the following Hartzell Propeller Inc. SB:

<b>Document No.</b>	<b>Pages</b>	<b>Date</b>
SB No. 202	1-5	January 5, 1995
Total pages: 5.		

This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Hartzell Propeller Inc., One Propeller Place, Piqua, OH 45356-2634; telephone (513) 778-4200, fax (513) 778-4391. Copies may be inspected at the FAA, New England Region, Office of the Assistant Chief Counsel, 12 New England Executive Park, Burlington, MA; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(h) This amendment becomes effective on June 12, 1995.

**FOR FURTHER INFORMATION CONTACT:**

Tomaso DiPaolo, Aerospace Engineer, Chicago Aircraft Certification Office, FAA, Small Airplane Directorate, 2300 East Devon Avenue, Room 232, Des Plaines, IL 60018; telephone (708) 294-7031, fax (708) 294-7834.