
Sektion 2. Utlandstillverkad flygmateriel

TITEL: Byte av höjdroderinfästningar

GÄLLER: Grob G 115 C och D alla S/N upp t o m 82077.

ÅTGÄRD: Utför åtgärder angivna i bifogad kopia av LBA AD 97-143.

TID FÖR ÅTGÄRD: 1. Inspektion efter 200 flygtimmar men ej senare än ett år efter utgivning av SB 1078-59/3, återinspektera vid varje 200:e flygtimme men minst en gång om året.

2. Byte av infästningar enligt SB 1078-64 senast den 31 december 1998 om ej tidigare utfört.

UNDERLAG: LBA AD 97-143 och däri angivet underlag.

REFERENS: LBA AD 97-143.

BESLUTSDATUM: 1997-06-25

LFS 1997:31

Åtgärder enligt LVD utgör nödvändig förutsättning för ifrågavarande flygmateriels luftvärdighet. Referens BCL M 1.11.

Anteckning om åtgärd, som vidtagits i enlighet med LVD, skall införas i teknisk journal för berörd flygmateriel med hänvisning till ifrågavarande LVD-nummer. Angivet underlag refererar till senast gällande revision/utgåva. LVD utges i luftfartsverkets författningssamlingar LFS.

Postadress	Gatuadress	Telefonnummer	Telegram Civilair	Telex
601 79 NORRKÖPING	Vikboplan 11	011-192000	Norrköping	62450



**Airworthiness
Directive
97-143**

Bilaga till LVD Nr 2780

Luftfahrt-Bundesamt
Airworthiness Directive Section
Lilienthalplatz 6
38108 Braunschweig
Federal Republic of Germany

Grob

Effective Date: May 22, 1997

Affected:

Kind of aeronautical product:	Aircraft
Manufacturer:	Grob, Mattsies, Germany
Type:	Grob G 115
Models affected:	Grob G 115 C and D
Serial numbers affected:	all, up to 82077
German Type Certificate No.:	1078

Subject:

Exchange of the elevator hinges.

Reason:

In the course of the inspection of all aircraft according to SB No. 1078-59/3 so far at 1 non acro and 2 acro aircraft outboard elevator hinges were found, which are supposed to be partly delaminated by overloading. The lowest number of operating hours of the concerned aircraft was 405.

Action:

Repetitive inspection until elevator hinges were changed.

Compliance:

Inspection of elevator hinges after 200 Flight Hours (FH), but not later than 1 year after execution of SB No. 1078-59/3. Reinspection every 200 FH, but at latest once a year.
Exchange of elevator hinges in accordance with SB No. 1078-64 not later than December 31, 1998, if not already has been done.

Technical publication of the manufacturer:

Grob Service Bulletin No. 1078-64 dated December 11, 1996 and SB No. 1078-64/2 dated April 08, 1997 which becomes herewith part of this AD and must be obtained from Messrs.:

Burkhart Grob Luft- und Raumfahrt

D-86874 Mattsies
Federal Republic of Germany

Accomplishment and log book entry:

Action to be accomplished by an approved service station and to be checked and entered in the log book by a licensed inspector.